
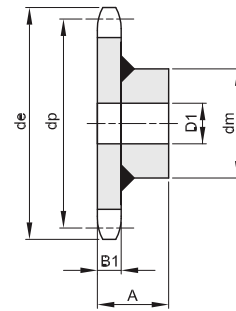


PASO 50
RODILLO 25

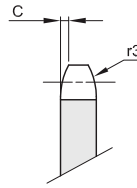



B1	C	r3
10,5	3	50

Material Fe(Hierro)

Z	de	dp	dm	D1	A	Kg.
6	121,0	100,00	58	20	40,5	1,11
7	136,0	115,24	58	20	40,5	1,37
8	151,5	130,65	58	20	40,5	1,55
9	167,0	146,20	58	20	40,5	1,89
10	183,0	161,80	88	25	45,5	3,10
11	198,5	177,50	88	25	45,5	3,44
12	214,0	193,20	88	25	45,5	3,79
13	230,0	208,95	88	25	45,5	4,17
14	245,5	224,70	88	25	45,5	4,63
15	261,5	240,45	88	25	45,5	5,09
16	277,5	256,30	118	30	60,5	8,26
17	293,0	272,11	118	30	60,5	9,10
18	309,0	287,95	118	30	60,5	9,26
19	325,0	303,80	118	30	60,5	10,32
20	340,5	319,60	118	30	60,5	10,42

Z	de	dp	dm	D1	A	Kg.
21	356,5	335,45	118	30	60,5	11,71
22	372,5	351,35	118	30	60,5	12,20
23	388,0	367,20	118	30	60,5	12,47
24	404,0	383,05	118	30	60,5	13,00
25	420,0	398,95	118	30	60,5	13,98
28	467,5	446,55	133	30	62	18,62
30	499,5	478,35	133	30	62	20,29
35	579,0	557,80	133	30	62	24,57
38	626,5	605,45	133	30	62	26,97

PASO 50
RODILLO 31

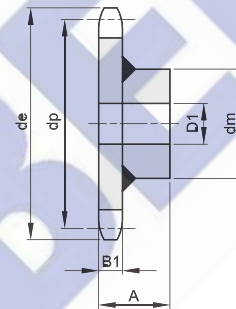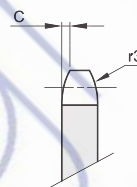

B1	C	r3
13,5	3	50

Material Fe(Hierro)

Z	de	dp	dm	D1	A	Kg.
6	120,0	100,00	58	20	43,5	1,18
7	135,0	115,24	58	20	43,5	1,44
8	150,5	130,65	58	20	43,5	1,72
9	166,0	146,20	58	20	43,5	2,05
10	182,0	161,80	88	25	48,5	3,40
11	197,5	177,50	88	25	48,5	3,80
12	213,0	193,20	88	25	48,5	4,30
13	229,0	208,95	88	25	48,5	4,78
14	244,5	224,70	88	25	48,5	5,37
15	260,5	240,45	88	25	48,5	5,98
16	276,5	256,30	118	30	63,5	9,05
17	292,0	272,11	118	30	63,5	9,60
18	308,0	287,95	118	30	63,5	10,30
19	324,0	303,80	118	30	63,5	11,10
20	339,5	319,60	118	30	63,5	11,90

Z	de	dp	dm	D1	A	Kg.
21	355,5	335,45	118	30	63,5	12,75
22	371,5	351,35	118	30	63,5	13,54
23	387,0	367,20	118	30	63,5	14,38
24	403,0	383,05	118	30	63,5	15,35
25	419,0	398,95	118	30	63,5	16,40
26	435,0	414,80	133	30	65	18,81
28	466,5	446,55	133	30	65	21,00
30	498,5	478,35	133	30	65	23,42
32	530,0	510,10	133	30	65	25,93
38	625,5	605,45	133	30	65	32,10